

Inspection Report

James Customer Jenny Customer

Property Address:

9999 Main Street Greenwood IN 46999



Crawford Home Inspections

Brian Crawford HI01400056 2230 Stafford Rd Ste 115 Plainfield, IN 46168

Table of Contents

Cover Page	<u>1</u>
Table of Contents	2
Intro Page	3
1 Exterior	4
2 Roofing / Chimneys / Roof Structure	7
3 Attic	g
4 Garage	10
5 Kitchen Components and Appliances	11
6 Bathroom and Components	13
7 Interior	14
8 Foundation and Structural Components	
9 Plumbing System	
10 Electrical System	20
11 Heating / Central Air Conditioning	
General Summary	
Repair Summary	
Attachments	

9999 Main Street Page 2 of 28

Date: 10/5/2015	Time: 09:00 AM	Report ID: 15-9999
Property:	Customer:	Real Estate Professional:
9999 Main Street	James Customer	Betty Agent
Greenwood IN 46999	Jenny Customer	ABC Realtors

Comment Key or Definitions

The following definitions of comment descriptions represent this inspection report. All comments by the inspector should be considered before purchasing this home. Any recommendations by the inspector to repair or replace suggests a second opinion or further inspection by a qualified contractor. All costs associated with further inspection fees and repair or replacement of item, component or unit should be considered before you purchase the property.

Function (OK) = I visually observed the item, component or unit and if no other comments were made then it appeared to be functioning as intended allowing for normal wear and tear.

Marginal (M) = I visually observed the item, component or unit and found it to be performing only some of its intended functions. Repairs are required to make functional.

Repair or Replace (RR) = The item, component or unit is not functioning as intended, or needs further inspection by a qualified contractor. Items, components or units that can be repaired to satisfactory condition may not need replacement.

Not Inspected (NI)= I did not inspect this item, component or unit and made no representations of whether or not it was functioning as intended and will state a reason for not inspecting.

Not Present (NP) = This item, component or unit is not in this home or building.

Standards of Practice:	In Attendance:	Type of building:
INACHI National Association of Certified	Vacant (inspector only)	Single Family (2 story)
Home Inspectors		
Style of Home:	Approximate age of building:	Home Faces:
Contemporary	Over 10 Years	West
Temperature:	Weather:	Ground/Soil surface condition:
Over 65	Clear	Dry
Rain in last 3 days:	Radon Test:	Water Test:
No	No	No

9999 Main Street Page 3 of 28

1. Exterior

The home inspector shall observe: Wall cladding, flashings, and trim; Entryway doors and a representative number of windows; Garage door operators; Decks, balconies, stoops, steps, areaways, porches and applicable railings; Eaves, soffits, and fascias; and Vegetation, grading, drainage, driveways, patios, walkways, and retaining walls with respect to their effect on the condition of the building. The home inspector shall: Describe wall cladding materials; Operate all entryway doors and a representative number of windows; Operate garage doors manually or by using permanently installed controls for any garage door operator; Report whether or not any garage door operator will automatically reverse or stop when meeting reasonable resistance during closing; and Probe exterior wood components where deterioration is suspected. The home inspector is not required to observe: Storm windows, storm doors, screening, shutters, awnings, and similar seasonal accessories; Fences; Presence of safety glazing in doors and windows; Garage door operator remote control transmitters; Geological conditions; Soil conditions; Recreational facilities (including spas, saunas, steam baths, swimming pools, tennis courts, playground equipment, and other exercise, entertainment, or athletic facilities); Detached buildings or structures; or Presence or condition of buried fuel storage tanks. The home inspector is not required to: Move personal items, panels, furniture, equipment, plant life, soil, snow, ice or debris that obstructs access or visibility.

Styles & Materials

Foundation:	Window Wells:	Siding Style:

Concrete Other Bevel **Brick**

Siding Material: Exterior Entry Doors: Storm Windows:

Vinyl Steel No

Brick veneer

Screens: Appurtenance (attached structures): Driveway:

Yes Deck with steps Concrete

Sidewalk

Proper Railing and Hand Rails

Faucets: **Outlets:**

GFI - Yes Frostproof Front Back

Back

		OK	M	RR	NI	NP
1.0	Vegetation, Grading, Drainage, Driveways, Patio Floor, Walkways and Retaining Walls (With respect to their effect on the condition of the building)	•				
1.1	Foundation		•			
1.2	Window Wells	•				
1.3	Wall Cladding, Flashing and Trim		•			
1.4	Eaves, Soffits and Fascias		•			
1.5	Doors (Exterior)			•		
1.6	Windows (Also see Interior Rooms)	•				
1.7	Decks, Balconies, Balconies, Stoops, Steps, Areaways, Porches, Patio/Cover and Applicable Railings	•				
1.8	Plumbing Water Faucets (hose bibs)	•				
1.9	Outlets (Exterior)	•				
OK=	Functional, M= Marginal, RR= Repair or Replace, NI= Not Inspected, NP= Not Present	ок	М	RR	NI	NP

Comments:

9999 Main Street Page 4 of 28 **1.1** The opening around the air conditioner line requires sealing. This will prevent water and bugs from entering the home.



1.1 Item 1(Picture)

1.3 The trim around the garage door requires painting to prevent decay.





1.3 Item 1(Picture)

1.3 Item 2(Picture)

1.4 There is trim above the garage that requires adjustment to prevent further damage.



1.4 Item 1(Picture)

9999 Main Street Page 5 of 28

1.5 The rear door entering the garage requires repair to the wood frame due to decay and then painted to prevent further damage.



1.5 Item 1(Picture)

The exterior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

9999 Main Street Page 6 of 28

2. Roofing / Chimneys / Roof Structure

The home inspector shall observe: Roof covering; Roof drainage systems; Flashings; Skylights, chimneys, and roof penetrations; and Signs of leaks or abnormal condensation on building components. The home inspector shall: Describe the type of roof covering materials; and Report the methods used to observe the roofing. The home inspector is not required to: Walk on the roofing; or Observe attached accessories including but not limited to solar systems, antennae, and lightning arrestors.

Styles & Materials

Viewed roof covering from: Roof-Type: Roof Covering:

Ground Gable Architectural

Ladder Medium

Binoculars

Roof Info: Chimney (exterior): Sky Light(s):

1 Layer Vinyl siding None

Less than 5 years

Roof Ventilation: Gutters/Downspouts: Splashblocks:

Soffit Vents Aluminum Some

Passive

		UK	IVI	KK	NI	NP
2.0	Roof Coverings	•				
2.1	Flashings	•				
2.2	Skylights, Chimneys and Roof Penetrations	•				
2.3	Roof Ventilation	•				
2.4	Roof Drainage Systems (gutters and downspouts)		•			

OK= Functional, M= Marginal, RR= Repair or Replace, NI= Not Inspected, NP= Not Present

OK M RR NI NP

Comments:

2.4 Downspout on right rear corner needs adjusted to direct water away from the foundation.



2.4 Item 1(Picture)

9999 Main Street Page 7 of 28

The roof of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Roof coverings and skylights can appear to be leak proof during inspection and weather conditions. Our inspection makes an attempt to find a leak but sometimes cannot. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

9999 Main Street Page 8 of 28

3. Attic

The Home Inspector shall observe structural components including foundations, floors, walls, columns or piers, ceilings and roof. The home inspector shall describe the type of Foundation, floor structure, wall structure, columns or piers, ceiling structure, roof structure. The home inspector shall: Probe structural components where deterioration is suspected; Enter under floor crawl spaces, basements, and attic spaces except when access is obstructed, when entry could damage the property, or when dangerous or adverse situations are suspected; Report the methods used to observe under floor crawl spaces and attics; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to: Enter any area or perform any procedure that may damage the property or its components or be dangerous to or adversely effect the health of the home inspector or other persons.

Styles & Materials

Attic Access Location: Method used to observe attic:: **Roof Structure::**

Other From entry engineered wood trusses

Other: Master Closet Sheathing

Ceiling Structure:: Attic Info:: Attic Insulation::

Not Visible Scuttle hole Blown No Storage Unknown

R-30 or beter

		OK	M	RR	NI	NP
3.0	Roof Structure and Attic (Report leak signs or condensation)	•				
3.1	Ventaliatin Fans and Thermostatic Controls (Attic)					•
3.2	Insulation in Attic	•				
3.3	Visible electric Wiring in Attic	•				
OK=	Functional M= Marginal RR= Renair or Replace NI= Not Inspected NP= Not Present	OK	М	RR	NI	NP

Functional, M= Marginal, RR= Repair or Replace, NI= Not Inspected, NP= Not Present

Comments:

The structure of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

9999 Main Street Page 9 of 28

4. Garage

Styles & Materials

Garage Door Type: Garage Door Material: Auto-opener Manufacturer:
Two automatic Metal UNKNOWN

		OK	M	RR	NI	NP
4.0	Garage Ceiling	•				
4.1	Garage Walls (Including Firewall Separation)	•				
4.2	Garage Floor	•				
4.3	Garage Door (s)	•				
4.4	Occupant Door from Garage to inside home	•				
4.5	Garage Door Operators (Report whether or not doors will reverse when met with resistance)	•				

OK= Functional, M= Marginal, RR= Repair or Replace, NI= Not Inspected, NP= Not Present

OK M RR NI NP

Comments:

9999 Main Street Page 10 of 28

5. Kitchen Components and Appliances

The home inspector shall observe and operate the basic functions of the following kitchen appliances: Permanently installed dishwasher, through its normal cycle; Range, cook top, and permanently installed oven; Trash compactor; Garbage disposal; Ventilation equipment or range hood; and Permanently installed microwave oven. The home inspector is not required to observe: Clocks, timers, self-cleaning oven function, or thermostats for calibration or automatic operation; Non built-in appliances; or Refrigeration units. The home inspector is not required to operate: Appliances in use; or Any appliance that is shut down or otherwise inoperable.

Styles & Materials

Wood

Ceiling Materials: Wall Materials: Floor Coverings:

Drywall Drywall Tile

Interior Doors: Window Types: Window Manufacturer:

Hollow Core Single-hung Unknown

Thermal/Insulated

Dishwasher Brand: Disposer Brand: Exhaust/Range hood:

WHIRLPOOL UNKNOWN WHIRLPOOL

Range/Oven: Built in Microwave: Trash Compactors:

WHIRLPOOL WHIRLPOOL NONE

Laminate

Cabinetry: Countertop: Dryer Power Source:

NP OK M RR NI 5.0 Ceiling 5.1 Walls 5.2 Floor 5.3 Pantry/Closet Doors 5.4 Windows 5.5 Counters and a representative number of Cabinets 5.6 Plumbing Drain and Vent Systems 5.7 Plumbing Water Supply Faucets and Fixtures 5.8 Outlets Wall Switches and Fixtures 5.9 Dishwasher 5.10 Ranges/Ovens/Cooktops 5.11 Range Hood 5.12 Trash Compactor 5.13 Food Waste Disposer 5.14 Microwave Cooking Equipment 5.15 | Clothes Dryer Vent Piping

Gas Connection

OK

M

RR

NI

OK= Functional, M= Marginal, RR= Repair or Replace, NI= Not Inspected, NP= Not Present

9999 Main Street Page 11 of 28

Comments:

The built-in appliances of the home were inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

9999 Main Street Page 12 of 28

6. Bathroom and Components

The home inspector shall observe: Interior water supply and distribution system, including: piping materials, supports, and insulation; fixtures and faucets; functional flow; leaks; and cross connections; Interior drain, waste, and vent system, including: traps; drain, waste, and vent piping; piping supports and pipe insulation; leaks; and functional drainage; Hot water systems including: water heating equipment; normal operating controls; automatic safety controls; and chimneys, flues, and vents; Fuel storage and distribution systems including: interior fuel storage equipment, supply piping, venting, and supports; leaks; and Sump pumps. The home inspector shall describe: Water supply and distribution piping materials; Drain, waste, and vent piping materials; Water heating equipment; and Location of main water supply shutoff device. The home inspector shall operate all plumbing fixtures, including their faucets and all exterior faucets attached to the house, except where the flow end of the faucet is connected to an appliance. The home inspector is not required to: State the effectiveness of anti-siphon devices; Determine whether water supply and waste disposal systems are public or private; Operate automatic safety controls; Operate any valve except water closet flush valves, fixture faucets, and hose faucets; Observe: Water conditioning systems; Fire and lawn sprinkler systems; On-site water supply quantity and quality; On-site waste disposal systems; Foundation irrigation systems; Spas, except as to functional flow and functional drainage; Swimming pools; Solar water heating equipment; or Observe the system for proper sizing, design, or use of proper materials.

Styles & Materials

	ings: Drywall	Walls: Drywall		Floor: Vinyl					
	inetry:	Countertop:		Exhaust Fans:					
	Wood	Composiite		Fan with light					
					ок	M	RR	NI	NP
6.0	Ceiling				•				
6.1	Walls				•				
6.2	Floor				•				
6.3	Counters and Cabinets				•				
6.4	Doors (Representative number	er)			•				
6.5	Windows								•
6.6	Plumbing Drain, Waste and V	ent Systems			•				
6.7	Plumbing Water Supply and [Distribution Systems and Fix	xtures		•				
6.8	Outlets Switches and Fixtures	S			•				
6.9	Exhaust fan				•				
OK=	Functional, M= Marginal, RR= Re	pair or Replace, NI= Not Inspe	ected, NP= Not Present		ок	М	RR	NI	NP

Comments:

The plumbing in the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Washing machine drain line for example cannot be checked for leaks or the ability to handle the volume during drain cycle. Older homes with galvanized supply lines or cast iron drain lines can be obstructed and barely working during an inspection but then fails under heavy use. If the water is turned off or not used for periods of time (like a vacant home waiting for closing) rust or deposits within the pipes can further clog the piping system. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

9999 Main Street Page 13 of 28

7. Interior

The home inspector shall observe: Walls, ceiling, and floors; Steps, stairways, balconies, and railings; Counters and a representative number of installed cabinets; and A representative number of doors and windows. The home inspector shall: Operate a representative number of windows and interior doors; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to observe: Paint, wallpaper, and other finish treatments on the interior walls, ceilings, and floors; Carpeting; or Draperies, blinds, or other window treatments.

Styles & Materials

Ceiling Materials: Wall Material: Floor Covering(s):

Drywall Drywall Carpet

Laminated T&G

Interior Doors: Window Types: Window Manufacturer:

Hollow core Single-hung UNKNOWN

Thermal/Insulated

		OK	M	RR	NI	NP
7.0	Ceilings	•				
7.1	Walls	•				
7.2	Floors	•				
7.3	Steps, Stairways, Balconies and Railings	•				
7.4	Doors (Representative number)		•			
7.5	Windows (Representative number)	•				
7.6	Outlets, Switches Ceiling Fans and Fixtures		•			
OK-	Functional M- Marginal DP- Papair or Poplace NII- Not Inspected NIP- Not Present	OK	М	DD	NI	ND

OK= Functional, M= Marginal, RR= Repair or Replace, NI= Not Inspected, NP= Not Present

OK M RR NI NF

Comments:

7.4 There is one door in the basement that needs adjusted. It is to long and dragging the carpet. This is causing damage to the bottom of the door. This needs to be fixed to prevent further damage.



7.4 Item 1(Picture)

9999 Main Street Page 14 of 28

7.6 There's a loose cover plate in the Master Bedroom that needs attached.



7.6 Item 1(Picture)

The interior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection did not involve moving furniture and inspecting behind furniture, area rugs or areas obstructed from view. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

9999 Main Street Page 15 of 28

8. Foundation and Structural Components

The Home Inspector shall observe structural components including foundations, floors, walls, columns or piers, ceilings and roof. The home inspector shall describe the type of Foundation, floor structure, wall structure, columns or piers, ceiling structure, roof structure. The home inspector shall: Probe structural components where deterioration is suspected; Enter under floor crawl spaces, basements, and attic spaces except when access is obstructed, when entry could damage the property, or when dangerous or adverse situations are suspected; Report the methods used to observe under floor crawl spaces and attics; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to: Enter any area or perform any procedure that may damage the property or its components or be dangerous to or adversely effect the health of the home inspector or other persons.

Styles & Materials

Foundation: Method used to observe Crawlspace: Floor Structure:

Poured concrete No crawlspace Slab

Engineered floor trusses

Wall Structure: Columns or Piers: Floor System Insulation:

Masonry Steel screw jacks NONE

2 X 4 Wood

		OK	M	RR	NI	NP
8.0	Foundations, Basements and Crawlspaces (Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components.)	•				
8.1	Walls (Structural)	•				
8.2	Columns or Piers	•				
8.3	Floors (Structural)	•				
8.4	Ceilings (Structural)	•				
8.5	Insulation under Floor System					•
8.6	Vapor Retarders (On ground in crawlspace or basement)				•	
8.7	Ventilation of Foundation Area (crawlspace or basement)					•

OK= Functional, M= Marginal, RR= Repair or Replace, NI= Not Inspected, NP= Not Present

OK M RR NI NP

Comments:

The structure of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

9999 Main Street Page 16 of 28

9. Plumbing System

The home inspector shall observe: Interior water supply and distribution system, including: piping materials, supports, and insulation; fixtures and faucets; functional flow; leaks; and cross connections; Interior drain, waste, and vent system, including: traps; drain, waste, and vent piping; piping supports and pipe insulation; leaks; and functional drainage; Hot water systems including: water heating equipment; normal operating controls; automatic safety controls; and chimneys, flues, and vents; Fuel storage and distribution systems including: interior fuel storage equipment, supply piping, venting, and supports; leaks; and Sump pumps. The home inspector shall describe: Water supply and distribution piping materials; Drain, waste, and vent piping materials; Water heating equipment; and Location of main water supply shutoff device. The home inspector shall operate all plumbing fixtures, including their faucets and all exterior faucets attached to the house, except where the flow end of the faucet is connected to an appliance. The home inspector is not required to: State the effectiveness of anti-siphon devices; Determine whether water supply and waste disposal systems are public or private; Operate automatic safety controls; Operate any valve except water closet flush valves, fixture faucets, and hose faucets; Observe: Water conditioning systems; Fire and lawn sprinkler systems; On-site water supply quantity and quality; On-site waste disposal systems; Foundation irrigation systems; Spas, except as to functional flow and functional drainage; Swimming pools; Solar water heating equipment; or Observe the system for proper sizing, design, or use of proper materials.

Styles & Materials

Water Source: Water Filters: Plumbing Water Supply (into home):

Public (We do not inspect filtration systems) Copper

Plumbing Water Distribution (inside home): Washer Drain Size: Plumbing Waste Line:

Copper Not visible PVC

Water Heater Power Source: Water Heater Capacity: Water Heater Manufacturer:

Gas (quick recovery) 50 Gallon (2-3 people) LOCHINVAR

Water Heater Location:

Basement
Utility Room

		OK	M	RR	NI	NP
9.0	Plumbing Drain, Waste and Vent Systems	•				
9.1	Plumbing Water Supply and Distribution Systems and Fixtures	•				
9.2	Hot Water Systems, Controls, Chimneys, Flues and Vents	•				
9.3	Main Water Shut-off Device (Describe location)	•				
9.4	Fuels Storage and Distribution Systems (Interior fuel storage, piping, venting, supports, leaks)	•				
9.5	Main Fuel Shut-off (Describe Location)	•				
9.6	Sump Pump				•	


OK= Functional, M= Marginal, RR= Repair or Replace, NI= Not Inspected, NP= Not Present

OK M RR NI NP

Comments:

9999 Main Street Page 17 of 28

9.3 The main water shut off to the house is located on the left wall of the utility room in the basement. Just to the right of the escape window.

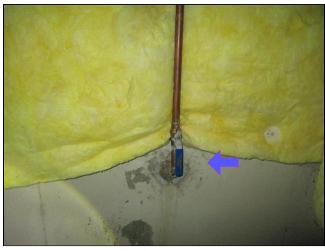

9.3 Item 1(Picture)

9.5 The main gas shut off to the home is located in the utility room in the basement. Just to the left as you walk in.



9.5 Item 1(Picture)

9.6 I was unable to test the sump pump because it had a submersed switch and a sealed lid. I found no evidence of water back up and the pump appears to be working properly.



9.6 Item 1(Picture)

9999 Main Street Page 18 of 28

The plumbing in the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Washing machine drain line for example cannot be checked for leaks or the ability to handle the volume during drain cycle. Older homes with galvanized supply lines or cast iron drain lines can be obstructed and barely working during an inspection but then fails under heavy use. If the water is turned off or not used for periods of time (like a vacant home waiting for closing) rust or deposits within the pipes can further clog the piping system. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

9999 Main Street Page 19 of 28

RR NI

10. Electrical System

The home inspector shall observe: Service entrance conductors; Service equipment, grounding equipment, main over current device, and main and distribution panels; Amperage and voltage ratings of the service; Branch circuit conductors, their over current devices, and the compatibility of their ampacities and voltages; The operation of a representative number of installed ceiling fans, lighting fixtures, switches and receptacles located inside the house, garage, and on the dwelling's exterior walls; The polarity and grounding of all receptacles within six feet of interior plumbing fixtures, and all receptacles in the garage or carport, and on the exterior of inspected structures; The operation of ground fault circuit interrupters; and Smoke detectors. The home inspector shall describe: Service amperage and voltage; Service entry conductor materials; Service type as being overhead or underground; and Location of main and distribution panels. The home inspector shall report any observed aluminum branch circuit wiring. The home inspector shall report on presence or absence of smoke detectors, and operate their test function, if accessible, except when detectors are part of a central system. The home inspector is not required to: Insert any tool, probe, or testing device inside the panels; Test or operate any over current device except ground fault circuit interrupters; Dismantle any electrical device or control other than to remove the covers of the main and auxiliary distribution panels; or Observe: Low voltage systems; Security system devices, heat detectors, or carbon monoxide detectors; Telephone, security, cable TV, intercoms, or other ancillary wiring that is not a part of the primary electrical distribution system; or Built-in vacuum equipment.

Styles & Materials

Electrical Service Conductors: Panel capacity: Panel Type:

Below ground 200 AMP Circuit breakers

100 AMP

Electric Panel Manufacturer: Branch wire 15 and 20 AMP: Wiring Methods:

CUTLER HAMMER Copper Romex


	OK	M	RR	NI	NP
Service Entrance Conductors	•				
Service and Grounding Equipment, Main Overcurrent Device, Main and Distribution Panels	•				
Branch Circuit Conductors, Overcurrent Devices and Compatability of their Amperage and Voltage	•				
Connected Devices and Fixtures (Observed from a representative number operation of ceiling fans, lighting fixtures, switches and receptacles located inside the house, garage, and on the dwelling's exterior walls)			•		
Polarity and Grounding of Receptacles within 6 feet of interior plumbing fixtures, and all receptacles in garage, carport and exterior walls	•				
Operation of GFCI (Ground Fault Circuit Interrupters)	•				
Location of Main and Distribution Panels	•				
Smoke Detectors				•	
Carbon Monoxide Detectors				•	
	Service and Grounding Equipment, Main Overcurrent Device, Main and Distribution Panels Branch Circuit Conductors, Overcurrent Devices and Compatability of their Amperage and Voltage Connected Devices and Fixtures (Observed from a representative number operation of ceiling fans, lighting fixtures, switches and receptacles located inside the house, garage, and on the dwelling's exterior walls) Polarity and Grounding of Receptacles within 6 feet of interior plumbing fixtures, and all receptacles in garage, carport and exterior walls Operation of GFCI (Ground Fault Circuit Interrupters) Location of Main and Distribution Panels Smoke Detectors	Service Entrance Conductors Service and Grounding Equipment, Main Overcurrent Device, Main and Distribution Panels Branch Circuit Conductors, Overcurrent Devices and Compatability of their Amperage and Voltage Connected Devices and Fixtures (Observed from a representative number operation of ceiling fans, lighting fixtures, switches and receptacles located inside the house, garage, and on the dwelling's exterior walls) Polarity and Grounding of Receptacles within 6 feet of interior plumbing fixtures, and all receptacles in garage, carport and exterior walls Operation of GFCI (Ground Fault Circuit Interrupters) Location of Main and Distribution Panels Smoke Detectors	Service Entrance Conductors Service and Grounding Equipment, Main Overcurrent Device, Main and Distribution Panels Branch Circuit Conductors, Overcurrent Devices and Compatability of their Amperage and Voltage Connected Devices and Fixtures (Observed from a representative number operation of ceiling fans, lighting fixtures, switches and receptacles located inside the house, garage, and on the dwelling's exterior walls) Polarity and Grounding of Receptacles within 6 feet of interior plumbing fixtures, and all receptacles in garage, carport and exterior walls Operation of GFCI (Ground Fault Circuit Interrupters) Location of Main and Distribution Panels Smoke Detectors	Service Entrance Conductors Service and Grounding Equipment, Main Overcurrent Device, Main and Distribution Panels Branch Circuit Conductors, Overcurrent Devices and Compatability of their Amperage and Voltage Connected Devices and Fixtures (Observed from a representative number operation of ceiling fans, lighting fixtures, switches and receptacles located inside the house, garage, and on the dwelling's exterior walls) Polarity and Grounding of Receptacles within 6 feet of interior plumbing fixtures, and all receptacles in garage, carport and exterior walls Operation of GFCI (Ground Fault Circuit Interrupters) Location of Main and Distribution Panels Smoke Detectors	Service Entrance Conductors Service and Grounding Equipment, Main Overcurrent Device, Main and Distribution Panels Branch Circuit Conductors, Overcurrent Devices and Compatability of their Amperage and Voltage Connected Devices and Fixtures (Observed from a representative number operation of ceiling fans, lighting fixtures, switches and receptacles located inside the house, garage, and on the dwelling's exterior walls) Polarity and Grounding of Receptacles within 6 feet of interior plumbing fixtures, and all receptacles in garage, carport and exterior walls Operation of GFCI (Ground Fault Circuit Interrupters) Location of Main and Distribution Panels Smoke Detectors

 ${\sf OK=Functional,\,M=Marginal,\,RR=Repair\,or\,Replace,\,Nl=\,Not\,Inspected,\,NP=\,Not\,Present}$

Comments:

9999 Main Street Page 20 of 28

10.3 There is a switch in the great room (with fireplace) that has a switch taped in the on position. I have no idea why this would be taped in the on position and recommend that this be inspected by a qualified Electrician to determine if this is a hazard.

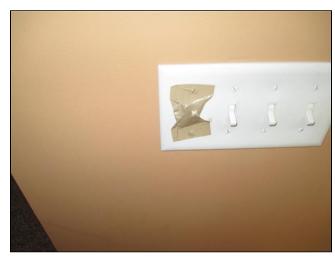

10.3 Item 1(Picture)

- **10.7** The smoke detectors worked at the time of the inspection, but are older. I recommend testing smoke detectors twice a year and replacing as needed.
- **10.8** I do not test carbon monoxide detectors. Testing them is difficult and I recommend replacing them as they are inexpensive for safety.

The electrical system of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Outlets were not removed and the inspection was only visual. Any outlet not accessible (behind the refrigerator for example) was not inspected or accessible. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

9999 Main Street Page 21 of 28

11. Heating / Central Air Conditioning

The home inspector shall observe permanently installed heating and cooling systems including: Heating equipment; Cooling Equipment that is central to home; Normal operating controls; Automatic safety controls; Chimneys, flues, and vents, where readily visible; Solid fuel heating devices; Heat distribution systems including fans, pumps, ducts and piping, with supports, insulation, air filters, registers, radiators, fan coil units, convectors; and the presence of an installed heat source in each room. The home inspector shall describe: Energy source; and Heating equipment and distribution type. The home inspector shall operate the systems using normal operating controls. The home inspector shall open readily openable access panels provided by the manufacturer or installer for routine homeowner maintenance. The home inspector is not required to: Operate heating systems when weather conditions or other circumstances may cause equipment damage; Operate automatic safety controls; Ignite or extinguish solid fuel fires; or Observe: The interior of flues; Fireplace insert flue connections; Humidifiers; Electronic air filters; or The uniformity or adequacy of heat supply to the various rooms.

Styles & Materials

Heat Type: Energy Source: Number of Heat Systems (excluding wood):

One Forced Air Gas

Heat System Brand: Ductwork: Filter Type: **BRYANT** Insulated Disposable

and

Non-insulated

Filter Size: Types of Fireplaces: **Operable Fireplaces:**

20x20 Vented gas logs One

Number of Woodstoves: Cooling Equipment Type: Cooling Equipment Energy Source:

None Air conditioner unit Electricity

Central Air Manufacturer: Number of AC Only Units:

BRYANT None

		OK	M	RR	NI	NP
11.0	Heating Equipment	•				
11.1	Normal Operating Controls	•				
11.2	Automatic Safety Controls	•				
11.3	Distribution Systems (including fans, pumps, ducts and piping, with supports, insulation, air filters, registers, radiators, fan coil units and convectors)	•				
11.4	Presence of installed heat source in each room	•				
11.5	Chimneys, Flues and Vents (for fireplaces, gas water heaters or heat systems)	•				
11.6	Solid Fuel heating Devices (Fireplaces, Woodstove)					•
11.7	Gas/LP Firelogs and Fireplaces				•	
11.8	Cooling and Air Handler Equipment	•				
11.9	Presence of installed cooling source in each room	•				
OK= I	Functional, M= Marginal, RR= Repair or Replace, NI= Not Inspected, NP= Not Present	ОК	М	RR	NI	NP

Comments:

11.7 I do not test Gas/LP firelogs and fireplaces.

The heating and cooling system of this home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection is not meant to be technically exhaustive. The inspection does not involve removal and inspection behind service door or dismantling that would otherwise reveal something only a licensed heat contractor would discover. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

9999 Main Street Page 22 of 28

Customer

9999 Main Street Page 23 of 28

General Summary



Crawford Home Inspections

2230 Stafford Rd Ste 115 Plainfield, IN 46168

Customer

James Customer Jenny Customer

Address

9999 Main Street Greenwood IN 46999

1. Exterior

1.1 Foundation

Marginal

The opening around the air conditioner line requires sealing. This will prevent water and bugs from entering the home.

1.3 Wall Cladding, Flashing and Trim

Marginal

The trim around the garage door requires painting to prevent decay.

1.4 Eaves, Soffits and Fascias

Marginal

There is trim above the garage that requires adjustment to prevent further damage.

2. Roofing / Chimneys / Roof Structure

2.4 Roof Drainage Systems (gutters and downspouts)

Marginal

Downspout on right rear corner needs adjusted to direct water away from the foundation.

9999 Main Street Page 24 of 28

7. Interior

7.4 Doors (Representative number)

Marginal

There is one door in the basement that needs adjusted. It is to long and dragging the carpet. This is causing damage to the bottom of the door. This needs to be fixed to prevent further damage.

7.6 Outlets, Switches Ceiling Fans and Fixtures

Marginal

There's a loose cover plate in the Master Bedroom that needs attached.

Prepared Using HomeGauge http://www.HomeGauge.com : Licensed To Crawford

9999 Main Street Page 25 of 28

Repair Summary



Crawford Home Inspections

2230 Stafford Rd Ste 115 Plainfield, IN 46168

Customer

James Customer Jenny Customer

Address

9999 Main Street Greenwood IN 46999

The following items or discoveries indicate that these systems or components **do not function as intended** or **adversely affects the habitability of the dwelling**; or **warrants further investigation by a specialist**, or **requires subsequent observation**. This summary shall not contain recommendations for routine upkeep of a system or component to keep it in proper functioning condition or recommendations to upgrade or enhance the function or efficiency of the home. This Summary is not the entire report. The complete report may include additional information of concern to the customer. It is recommended that the customer read the complete report.

1. Exterior

1.5 Doors (Exterior)

Repair or Replace

The rear door entering the garage requires repair to the wood frame due to decay and then painted to prevent further damage.

10. Electrical System

10.3 Connected Devices and Fixtures (Observed from a representative number operation of ceiling fans, lighting fixtures, switches and receptacles located inside the house, garage, and on the dwelling's exterior walls)

Repair or Replace

9999 Main Street Page 26 of 28

10. Electrical System

There is a switch in the great room (with fireplace) that has a switch taped in the on position. I have no idea why this would be taped in the on position and recommend that this be inspected by a qualified Electrician to determine if this is a hazard.

Home inspectors are not required to report on the following: Life expectancy of any component or system; The causes of the need for a repair; The methods, materials, and costs of corrections; The suitability of the property for any specialized use; Compliance or non-compliance with codes, ordinances, statutes, regulatory requirements or restrictions; The market value of the property or its marketability; The advisability or inadvisability of purchase of the property; Any component or system that was not observed; The presence or absence of pests such as wood damaging organisms, rodents, or insects; or Cosmetic items, underground items, or items not permanently installed. Home inspectors are not required to: Offer warranties or quarantees of any kind; Calculate the strength, adequacy, or efficiency of any system or component; Enter any area or perform any procedure that may damage the property or its components or be dangerous to the home inspector or other persons; Operate any system or component that is shut down or otherwise inoperable; Operate any system or component that does not respond to normal operating controls; Disturb insulation, move personal items, panels, furniture, equipment, plant life, soil, snow, ice, or debris that obstructs access or visibility; Determine the presence or absence of any suspected adverse environmental condition or hazardous substance, including but not limited to mold, toxins, carcinogens, noise, contaminants in the building or in soil, water, and air; Determine the effectiveness of any system installed to control or remove suspected hazardous substances; Predict future condition, including but not limited to failure of components; Since this report is provided for the specific benefit of the customer(s), secondary readers of this information should hire a licensed inspector to perform an inspection to meet their specific needs and to obtain current information concerning this property.

Prepared Using HomeGauge http://www.HomeGauge.com : Licensed To Crawford

9999 Main Street Page 27 of 28



Crawford Home Inspections

2230 Stafford Rd Ste 115 Plainfield, IN 46168

Report Attachments

ATTENTION: This inspection report is incomplete without reading the information included herein at these links/attachments. Note If you received a printed version of this page and did not receive a copy of the report through the internet please contact your inspector for a printed copy of the attachments.

NPMA-33 Pest Form

9999 Main Street Page 28 of 28